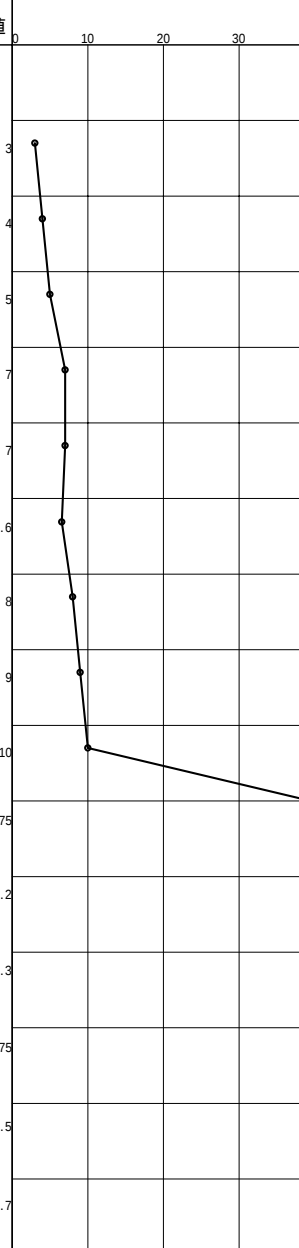




所在地 東京都新宿区荒木町2-10付近

標高	深度	層厚	柱状図	土質区分	色調	孔内水位 / 測定月日	標準貫入試験					N 値	N 値 - 深度図						
							深さ	10 cm ごと の打撃回数			打撃回数 / 貫入量								
								0	10	20									
尺	度	厚	図				度	10	20	30		値							
1	1.35	1.35	埋土 	暗褐	3.20		1.15				3 / 30	3							
2										1.45	1	1		1	30	3			
3										2.15		2		1	4	4			
4										2.45	1	12		8	30	4			
5										3.15					5	5			
6										3.45	1	2		2	30	5			
7										4.15	1	3		7	30	7			
8										4.45	8	12		3	30	7			
9										5.15					7	7			
10										5.45	2	2		3	30	7			
11	7.00	5.65	ローム 	茶褐	3.20		6.15			3	7	6.6							
12										6.47	2	2	12	32	6.6				
13										7.15				8	8				
14										7.45	2	3	3	30	8				
15										8.15				9	9				
16										8.45	2	3	4	30	9				
17										9.15				10	10				
18										9.45	3	3	4	30	10				
19	9.90	2.90					粘土 	黄褐	3.20		10.15				50	7.5			
20														10.35	23	27		20	7.5
21						11.15						26		50	8.2				
22						11.32					24	7		17	8.2				
23						12.15						27		50	8.3				
24						12.33					23	8		18	8.3				
25	13.00	3.10	細砂 	暗茶褐	3.20						13.15				50	7.5			
26														13.35	24	26		20	7.5
27														14.15		14		50	6.2
28														14.39	17	19	4	24	6.2
29	15.00	2.00					中砂 	褐灰	3.20		15.15		18		50	5.1			
30														15.44	14	18	9	29	5.1
31														16.15			10	50	7.1
32														16.36	15	25	1	21	7.1
33	16.36	1.36									細砂 	黄灰	3.20						