
新宿区地盤資料

調査整理番号 026-009

所在地 東京都新宿区新宿五丁目7-8付近

この資料は区内で建築されるための地盤の状況を確認するための参考資料です。 位置情報については、おおよその位置を示したものとなります。

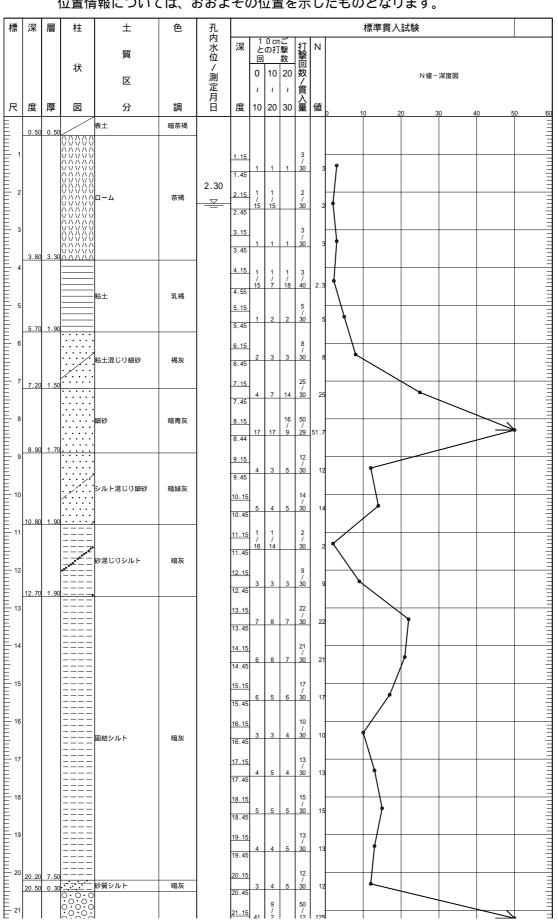

20.50	0.30		砂質シルト	暗灰		3	4	5	30	12	•			(イ569)	'
		0.0.0	デー 砂質シルト)・○ (・)		20.45	1	9		50			_	+_		
		0.0.0			21.15	41	/		/ 12	405	_		\vdash		
		0.000			21.27	41	2		12	125					
			1			50			50						
		0.0.0	1		22.15	/			/				-		
]		22.24	9			9	167					
				暗青灰											
			砂礫	暗褐	23.15		30		50					+	_
			()	7814	23.34	20	9		19	78.9				-	
					20.04										
					24.15		8 / 1		50 / 11						
		0.00			24.26		1		11	136				-	
		62000			25.15			7	50 /				1		
25.30	4.80		-			23	20	9	/ 29	51.7				$ \rightarrow$	
			1		25.44										
			1		26.15				50						
			1			17	19	14	/ 30	50				<i> </i>	
					26.45										
					27.15				41				-	+/-	
						11	13	17	/ 30	41				8	
		·. ·. ·.			27.45										
					28.15				25				\leftarrow		_
						6	8	11	/ 30	25		<			
					28.45							\			
		· · · · · ·			29.15				33				$\overline{}$		
						10	12	11	/ 30	33			\		
			-		29.45								\		
			-	黄褐灰	30.15				38		_		+-		
			1	與何次 ~ 暗青灰		12	13	13	/ 30	38			&	1	
			tm T-b	1	30.45										
			.細砂	黄褐灰	31.15			19	50 /		_		+		_
			1	暗青灰 ~		12	19	8	28	53.6				-	
]	褐灰	31.43										
			[32.15		29		50 /				+		
			[32.34	1 21	9		19	78.9				-	
		· · · · · ·					10		E0.						
		·			33.15]	16 / 3		50 /		_		+		
					33.28	34	3		13	115				-	
		·													
		:.:::::			34.15		18		50 /		-		+		
					34.29	1 32	4		14	107					
							8		50						
		[•		35.15	4.0	8 / 1		/	4,,	_		+		
		[.[35.26		1		11	136					
			•												
			•		36.15			15	50				+		_
			.1	1 1		14	21	4		62.5			1	· —	